

# PALIGHT

## Fabrication Guide

### Flat Foamed PVC Sheet



Bay Plastics Ltd

Unit H1 High Flatworth

Tyne Tunnel Trading Estate

North Shields

Tyne & Wear

NE29 7UZ

Tel: +44 (0) 191 258 0777


Fax: +44 (0) 191 258 1010

Email: [sales@bayplastics.co.uk](mailto:sales@bayplastics.co.uk)

# PALIGHT

## Contents

Subject		Subject	
Introduction to Palight	1	Adhesive Bonding of Palight	4
Features and Benefits	1	Heat Bending	5
Cutting	1	Thermoforming	5
Drilling	1	Heat Cycle	5
Milling	1	Processing Temperatures	5
Routing	1	Painting	6
Thermal Expansion / Contraction	2	Graphic Applications	7
Screwing and Nailing	2	Direct Digital Printing	8
Installation	2	Laminating	8
Exterior Signs	3	Chemical Resistance	11
Tips on Sign Installations with Posts	3	PSDS Information (Replaces MSDS)	15
Significant Items to be Considered	3	Recommended Uses and Restrictions	15
Screwed Joints	3	Further Information	15
Riveted Joints	3	Physical Properties Table	15
Frame Fastening of Flat Palight Sheets	3		
Handing Signs	3		

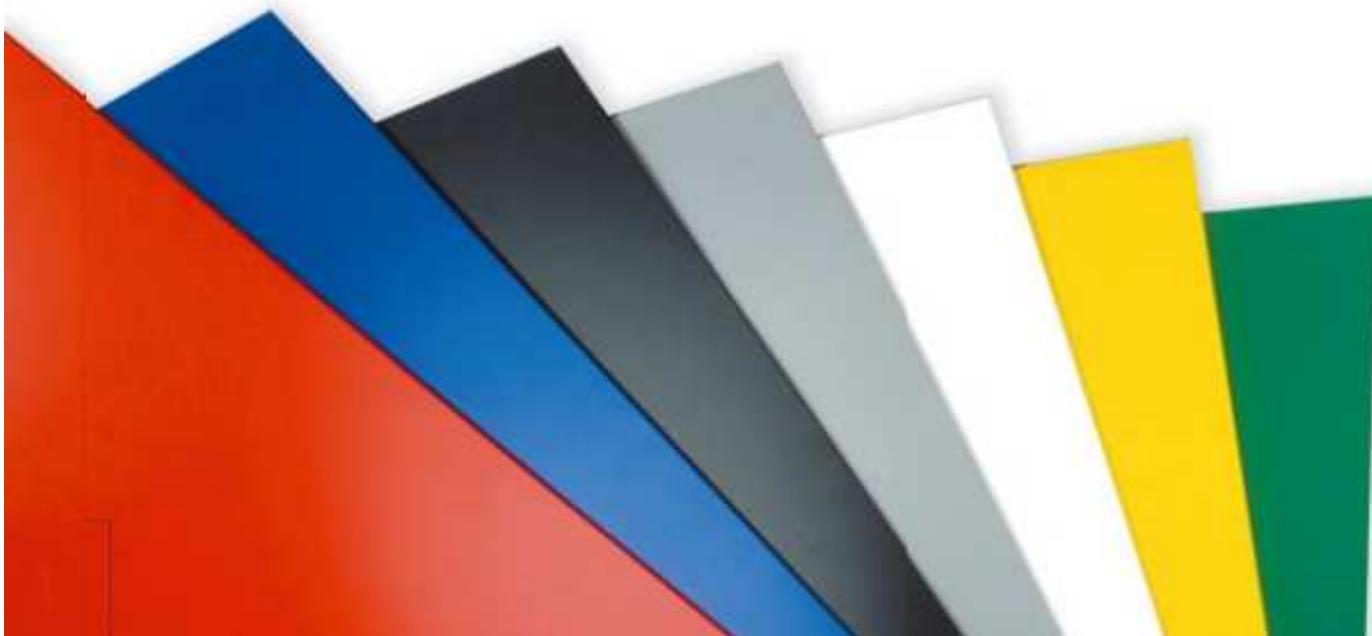

# FABRICATION GUIDE

## Introduction to Palight

Palight foamed PVC sheet is versatile, flexible, lightweight, and durable and is ideal for use digital or screen printing, fabrication, and construction. Palight Premium Foam PVC exhibits the whitest colour available and has been successfully tested and approved by digital flatbed printer manufacturers worldwide. Printers and display builders will benefit from its consistent, smooth, and bright surface for producing high quality displays. Palight is easily handled, cut and fabricated using conventional tools and equipment, and can be printed, painted or laminated.

## Features and Benefits

- ❖ Ease of fabrication
- ❖ Light weight
- ❖ Chemical resistant
- ❖ Superior insulating characteristics
- ❖ Moisture resistant
- ❖ Great flammability ratings
- ❖ Heavy metal free

## Cutting

### Circular Saws

Palight material up to 3mm thick can be cut with a knife or blade.

For Palight sheets 3mm and thicker, carbide-tipped, triple chip, ground type circular saws can be used.

The following settings are recommended:

- ❖ Rake angle: 0 to 15
- ❖ Clearance angle: 10 to 20
- ❖ Cutting speed: 4,000 to 8,000 feet per metre
- ❖ Feed: 70 to 90 feet per minute
- ❖ Tooth pitch: 0.080" to 0.040"

### Band Saws

High speed steel blades normally recommended for wood or plastic can be used for Palight material utilising the following guidelines:

- ❖ 6 to 8 teeth per inch
- ❖ Cutting speed: 3,000 to 5,000 feet per minute
- ❖ Feed: up to 40 feet per minute

### Saber Saws

Rough cut type blades ground for plastics can be used on Palight sheets. Smooth metal-cutting blades are not recommended.

## Drilling

Palight can be drilled with carbide-tipped bits using twist drills recommended for metals. The following settings are recommended:

- ❖ Point angle: between 90 to 110
- ❖ Spiral angle: 30
- ❖ Relief angle: 10
- ❖ Cutting speed: 150 to 1,300 feet per minute
- ❖ Feed rate: 0.01 to 0.02 inches per revolution

The minimum distance from the edge should be 2 times the hole diameter. In an effort to reduce heat build up during drilling of thicker Palight sheets.

# FABRICATION GUIDE

## Milling

Palight can be milled by using standard milling machines of various types utilising the following guidelines:

- ❖ Relief angle: 5 to 10
- ❖ Rake angle: -10 to 0
- ❖ Cutting speed: 3,000 to 3,500 feet per minute
- ❖ Cutting feed: 0.12 inches per revolution

## Routing

Palight material can be easily routed using multi-fluted carbide tools on standard woodworking routers. Standard tools and machines can be utilised with no need to alter equipment. Adjust feed and speed rates as needed to achieve the best edge finish on the Palight parts.

## Thermal Expansion / Contraction

As with most plastics, Palight foamed PVC will expand and contract with an increase or reduction in temperature. This material property is known as linear thermal expansion and contraction. Since Palight can be used in a wide variety of indoor and outdoor applications, linear thermal expansion and contraction may need to be considered during the fabrication and installation of the material. It is important to take into account the temperature at which the Palight material was fabricated as well as the temperature of the installation. Palight should not be used in applications or climatic conditions that exceed 140°F (ambient or surface temperature), at which temperature the Palight will soften and permanently deform. Dark colours are generally not recommended for outdoor use, as they absorb heat and can easily exceed the maximum allowable temperature of 140°C.

Palight Linear Expansion / Contraction Quick Reference

Total Temp Change	48 in	60 in	96 in	120 in
20°F	0.036	0.044	0.071	0.089
40°F	0.071	0.089	0.142	0.178
60°F	0.107	0.133	0.213	0.266
80°F	0.142	0.178	0.284	0.355
100°F	0.178	0.222	0.355	0.444
120°F	0.213	0.266	0.426	0.533
140°F	0.249	0.311	0.497	0.622

Distance Between Fastening Points for Screws & Rivet Joints

Sheet Thickness	Distance between fastening points
2mm	6 – 8 in
3mm	12 – 16 in
4mm	20 – 28 in
5mm	31 – 43 in
6mm	47 – 70 in

## Screwing and Nailing

Any type of screw or nail can be used to fasten Palight material. Power nailers and screw driving equipment are suggested. Inserting the screw or nail in an elongated slot or an oversized hole is recommended so that the material can expand or contract if fluctuations in temperature occur. For best results, use oversized washers or grommets in combination with screws.

## Installation

Palight is manufactured as an extruded foam PVC product with a directional grain running the entire length of the sheet. This manufacturing process gives Palight greater flexural strength in the direction of the extrusion. The grain of the Palight should always be installed perpendicular to the fastening point.

# FABRICATION GUIDE

## Exterior Signs

Palight, when used correctly and with basic mechanical fixing methods is suitable for exterior use. Using Palight can provide an excellent weatherproof sign substrate ready for screen printing, painting, or vinyl graphics.

## Tips on Sign Installations with Posts

The following tips have been compiled to be used as a general guide for fixing Palight for a minimum amount of breakage. Unusual designs falling outside the examples given may require certain modifications when considering Palight.

## Significant Items to be Considered

1. Bolt holes should always be larger than the bolt shaft to allow for thermal expansion and contraction, thus eliminating the possible stress at bolting fixing points. The use of washers spread the compressive load when bolts/nuts are tightened. Be sure not to over tighten as this will weaken the connection.
2. Split timber posts are the best to use because the Palight is supported evenly on both sides. If steel or aluminium poles are used, nylon bolts and washers give the best results. Be certain not to skimp on fasteners for these types of installation. They should be evenly spaced and away from the top and bottom edges.

## Screwed Joints

For the attachment of Palight, basically all known through bolts are acceptable, For outdoor mounting, it is recommended that the bolt shank be passed through the Palight in prepared holes or suitably dimensioned slots that leave adequate clearance between the bolt shank and the Palight. The screws should only be tightened firmly enough to allow the sheet to expand and contract in all directions without warping or buckling. Tapping screws or screws with form fitting passage of the shank through the sheet should be avoided, but are allowed for interior uses with predictably low temperature variations. The diameter of the hole or length of the slot should not be less than 2.5 times the shank diameter of the fastener. Disc washers should be used to cover the holes or to bridge the slots and they should be large enough to ensure adequate load distribution. Precise centring of the screws in holes and slots is essential to permit free movement of the sheet in all directions.

## Frame Fastening of Flat Palight Sheets

Palight can be fastened utilising various different framing materials such as, but not limited to, wood, aluminium, steel and vinyl. Besides the inherent rigidity of Palight sheets, which is dependent on thickness, all possible exterior stresses, e.g. wind pressure etc, must be taken into consideration in frame fastening. For appropriate mechanical and elastic property values the data sheet should be consulted. Dimensional changes due to thermal expansion (or contraction) must be taken into consideration by leaving sufficient clearance between the sheet edge and the frame.

## Hanging Signs

Palight may be successfully used as interior hanging signs. As Palight is an extruded sheet product, thin gauges or large hanging signs may require additional support. The addition of aluminium or thick walled plastic "C" channel across the top, bottom, or around the perimeter may be needed to alleviate any tendencies to warp. When the additions of supporting channels are not an option, the method illustrated below may also be used to help prevent bowing. Holes should be located 2-1/2 times material thickness from the edge.

# PALIGHT

## Adhesive Bonding of Palight

### General Information

Palight material can readily be bonded to itself or other materials. Commercially available adhesives that are suitable for bonding rigid PVC materials can be used for this purpose.

There are several considerations when choosing an adhesive:

1. The material to be bonded with Palight
2. Strength required – structural vs non-structural
3. Temperature range expected
4. Expansion/Contraction
5. Ease of application methods, curing times
6. Cost effectiveness
7. Environmental and safety considerations – flammability, fumes, odours etc.

### Surface Preparation

In order to attain the optimum bond, the Palight material surfaces to be bonded must be cleaned and degreased using a white cloth soaked in isopropyl alcohol.

### Selection of Adhesives

This selection of the proper adhesive for a project depends on the materials to be joined, as well as the end use and other considerations mentioned previously. The following suggestions serve as general guidelines:

- A. Bonding Palight material to Palight material
  1. For edge bonding and joining parts made of Palight material, use a PVC solvent such as (THF, MEK, Cyclohexanone solvent systems).
  2. For bonding large areas: If using PVC solvent such as pipe cement, spread with notched trowel and work rapidly.
- B. Bonding Palight material to Non-Porous Solid Material (such as PVC, other plastics or metal):
  1. Contact adhesive with solvent
    - a. Neoprene, nitrile, polyurethane or other synthetic rubber types.
    - b. Adhesive must be applied to both faces. Parallel beads of adhesion are often preferred because it allows evaporation of solvent providing faster cure.
    - c. Use a slow setting adhesive, when bonding large areas. This allows for more time to properly install the panels prior to the adhesive curing.
    - d. For bonding Palight material to flexible PVC sheets, only plasticiser-resistant types of adhesive should be used.
- C. Bonding Palight material to Porous Materials (such as paper, textiles, fabrics or wood).
  1. Contact adhesives with solvent: Same systems as for non-porous materials.
  2. Construction mastic, structural silicone adhesives.

Considerations such as expected temperature ranges (expansion/contraction), substrate and size of Palight material panels should be taken into consideration when deciding on a method of attachment.

### Heat Bending

Palight sheet material can be bent by using Calrods, radiant heaters, strip heaters or air-circulated ovens. Heat guns can also be used on small areas. To ensure best results, a rheostat should be used to control heating of the Palight so that the surface temperature does not exceed 340°F. Heating Palight material over 340°F can cause the surface to become rough and possibly discolour. When using metal contact strip heater, cover the heater strip with Teflon spray to prevent marking the Palight. Different sizes of rectangular heating bars can be used to produce bends of different radii. The larger the heated area of the Palight, the larger the radius that can be created. Palight should be heated from both sides when the sheet is thicker than 4mm. Palight requires heating at the rate approximately 30 to 40 seconds per millimetre of thickness prior to bending. To form tighter bends with smaller radii, use a small heated area on the upper surface (inside the bend) of the Palight sheet and a large heated area on the bottom surface (on the outside of the bend) of the sheet. A minimum radius of twice the sheet thickness is necessary to avoid breakage. When bending Palight into an angle, typically the extension of the Palight on either side of the angle should be at least 20 times the thickness of the Palight material. For example, 6mm (1/4") Palight would require the extension on each side to be 120mm (4-3/4") in order to avoid warping of the material. For sides less than 20 times the material's thickness, the entire sheet must be heated. Once the Palight is bent, place it in a fixture, such as a jig or clamp, to cool. Fans and/or compressed air will speed the cooling process.

# FABRICATION GUIDE

## Painting

The painting of Palight is easily accomplished with paints known to have compatibility with rigid PVC.

Selection of a paint system for each use should be guided by the following:

1. Cost effectiveness.
2. Ease of application.
3. Safety and environmental – odour, solvent systems, toxicity, etc.
4. Convenience and speed – one part vs two part, one coat vs multiple coats.
5. Solvent and/or chemical resistance.
6. Outdoor weatherability & reflectance value

(when painting Palight with darker colours, for use in exterior applications, it is imperative that the paint has a light reflectance value of 55 or higher in order to avoid excessive heat absorption, which will result in distortion of the Palight).

- I. Types of paints known compatible with Palight sheet
  - a. Vinyls
  - b. Acrylic lacquers
  - c. Two part polyurethanes

With Palight, water-based latex systems and oil-based enamels generally do not have the good adherence properties of solvent based systems. Although, the use of primers can improve the adherence of non-solvent based systems, the adherence is usually minimal.

- II. Surface Preparation
  - a. The surface to be printed must remain dry, clean, and grease free.
  - b. Any surface scratches on Palight will have a tendency to telegraph through the paint. In order to remove small scratches or dents, rapidly fan heat a heat gun over the affected area. Care must be taken not to leave the hot air in one place for too long, as the surface can be disformed.
  - c. It is highly recommended that the surface be cleaned with a rag moistened with isopropyl alcohol prior to painting.

- III. Adhesion Test
  - a. The paint system chosen should always be tested for adequate adhesion. To test for adhesion, conduct the Cross Hatch Test after the paint has dried for at least 24 hours.
    1. Make eleven parallel cuts 1/16" apart with a razor blade knife. Make eleven similar cuts at 90° to cross the first set.
    2. Across the scored area apply a strip of strong tape, such as #610 Scotch tape. Press firmly.
    3. Immediately remove the tape by pulling it back upon itself at 180° in one rapid motion.
    4. There shall be no removal of the paint squares to obtain a good adhesion rating.

- IV. Application
  - a. Paints can usually be applied with a brush roller, although conventional air spray equipment will provide a more consistent appearance.
  - b. Consult paint manufacturers literature for recommended application technique and thinning requirements.

- V. Drying

Palight is a thermoplastic material. It should not be dried at temperatures in excess of 150°F. For drying and curing times, consult paint manufacturers literature.

CAUTION: Due to the wide variety of paint products on the market, and the fact that some paints have been known to embrittle or bow Palight, testing is recommended for the initial use of any coating system before commercialisation.

# PALIGHT

## Graphic Applications

Palight performs superbly in a wide range of graphic applications including those involving paints, screen printing, digital flatbed printing and vinyl films. Palight can be used to create weather-resistant signs, displays or point of purchase (POP) materials. The smooth Palight surface is ideal for all types of graphics, and it requires little surface preparation or surface treatment.

## General Considerations

To ensure results for any graphic application using Palight, consider the following factors that may affect the finish installation:

- ❖ Environmental and safety concerns
- ❖ Weathering
- ❖ Chemical resistance
- ❖ Ease of application
- ❖ Cost effectiveness
- ❖ Hardness
- ❖ Scratch resistance
- ❖ Priming or multi-coat paint applications

TIP: Because of the wide range of products available, select paints carefully for each application. Initial testing of the selected paint system is recommended before a production run.

## Cleaning / Pretreating

Before screen printing or painting Palight, the surface area should be cleaned with isopropyl alcohol and a clean white cloth. Depending on the specific application, certain pre-treatments may also be required, as described in the following sections.

## Screen Printing

With Palight, the process of screen printing is easily accomplished. The surface of PALIGHT has a closed cell matte finish that makes mistakes easily wipe off with the appropriate thinner. The use of Vinyl and Vinyl/acrylic, solvent based inks are very compatible with PALIGHT. The use of Water Based Screen Printing Inks has also had some success with PALIGHT material. Ink manufacturer directions must be followed for good adhesion. Surface preparation of PALIGHT for screen printing is similar to those of painting.

- A. The surface to be screen printed area must remain dry, clean, and grease free.
- B. Any surface scratches on the PALIGHT will have a tendency to shadow through the ink.

In order to remove small scratches or dents, rapidly fan a heat gun over the affected area. Care must be taken not to leave the hot air in one place for too long, as the surface can become deformed. It is highly recommended that the surface be cleaned with a white cloth moistened with isopropyl alcohol prior to printing. All screen printing inks should be tested in a manner which duplicates your printing process before initiating production. It is strongly recommended to consult the appropriate ink manufacturer regarding any required ink additives such as catalyst for proper adhesion and exterior usage. Screen Printing ink should air dry, rather than be heat dried. Temperatures in excess of 150° F may cause warping or bowing of PALIGHT material. Most UV Screen Printing Inks that are compatible with rigid PVC will work on PALIGHT. The most important factor to be considered when using UV systems is the curing oven. Low wattage bulbs should be used to keep the temperature below 150° F. The use of UV curing systems, which have variable speed conveyors, are considered the best type to use with PALIGHT.

## Direct Digital Printing

Wide format and flatbed printers use various ink and ink curing technologies to allow high quality printing at relatively high speeds.

High quality digital printing depends on various factors:

- ❖ Printer capabilities
- ❖ Ink technology and quality
- ❖ Type of printing substrate and quality
- ❖ Machine operator

PALIGHT'S bright whiteness enables printers to print directly on it and achieve accurate, consistent colour values and brightness.

# FABRICATION GUIDE

## Protective Film Masking

The protective polyethylene film mask helps prevent surface abrasion and stains. However, removing the protective film may cause an increase of static electric charge, which can affect ink coverage. Therefore, after peeling the film away from the sheet, the static electricity that has built up in the sheet should be discharged using an ionized gun or a suitable device provided by the printer manufacture.

## Cleaning Palight and Preparing for Printing

The surface should be clean before printing. Carefully inspect each panel to ensure there is no: dust, fingerprints, residue or other problematic substances that may affect ink coverage or adhesion. If needed, the PALIGHT should be cleaned with a damp rag, or with isopropyl alcohol.

## Ink

PALIGHT is suitable for all types of inks: Aqueous, Solvent-Based, and UV-curable. In fact, PALIGHT has been tested and approved by major printer OEM's around the world, including AGFA, Gandinnovations, HP, Mutoh, Océ, and more. Consult the printer manual or contact the printer manufacturer for recommendations and compatibility information.

## Drying the ink

The two main drying technologies are:

IR (Infrared) – Long exposure to high temperature in the drying tunnel may cause distortions in the sheet.

UV (Ultraviolet) – UV levels must be adjusted according the printing speed and substrate. UV overexposure can cause discoloration of both the ink and substrate.

## Print Head Adjustment

The distance between the print head and the substrate can have a significant effect on print quality. Manufacturer specifications, combined with an operator experience, should determine print head distance from the substrate. The suggested starting distance should not be more than 2 mm from the print head to the substrate.

## Laminating

PALIGHT is an ideal material for applications that require lamination. This section provides preparation information processes as well as detailed instructions for the various types of lamination that can be used with PALIGHT. Because prints are one of the most frequently laminated materials, the sections that follow will generally refer the lamination of a print, although many other materials can be used.

Please Note! Since PALIGHT material may warp when heated above 150°F or when heated from one side only, it cannot be used in any lamination process requiring heat.

## Adhesion

For best results, the PALIGHT material should be cleaned with isopropyl alcohol prior to adhesion and allowed to dry thoroughly. When laminating with pressure-sensitive adhesives, a force of 25–40 psi is required. Proper spacers are also critical. Because force must be applied equally across the material, the top roll must move evenly from left to right while maintaining even contact between top and bottom laminating rolls. To achieve even contact, "zero the nip," then use spacer shims to preset the nip opening for a particular laminate. Use sufficient pressure to completely eliminate any air bubbles between the PALIGHT material, the adhesive and the print or other material. The lamination will achieve maximum bonding in three hours. If the lamination has been performed properly, the finished mount can be flexed without the print becoming loose in the centre. To prevent moisture from becoming trapped between layers of porous material (such as paper) and creating blisters, the level of moisture in both the material to be laminated and the atmosphere should be reduced before pressing. Some materials may require pre-drying. PALIGHT is nonporous and does not need pre-drying.

## Preventing Surface flaws

Surface blemishes, such as wrinkles, can be caused by misalignment of the adhesive roll or too much pressure or rollers that are not parallel. Trapped dirt or lumps of hardened adhesive common with glossy prints may create small bumps in the finished product. In order to prevent these problems, equipment used for PALIGHT lamination must be kept clean. Use a fresh roll or sheet of transfer adhesive if bumps are caused by hardened adhesive. Dirt problems can be minimized by using an ionizing static eliminator. Using prints or other materials made with a paper 0.007" or thicker can help prevent strike through. For best results, wipe down the back of the print and the face of the PALIGHT mount with a clean, dry cloth before it passes through the roll nip. Whether the finished product is to be used indoors or outdoors, a clear, high gloss overlay will help protect against fading as well as enhance the colour.

## Laminating Techniques

Four techniques are recommended for laminating materials to PALIGHT, as described in the following sections. Depending upon the type of applications and the equipment available, one or more of these processes may be appropriate for a particular application. None of these processes involves the use of heat. Because PALIGHT may warp at temperatures above 140 F or when heated from one side only, it cannot be dry mounted or hot mounted.

# PALIGHT

The four recommended lamination techniques for PALIGHT are:

- ❖ Cold laminating with a press using adhesive-backed paper
- ❖ Cold laminating using a vacuum press
- ❖ Hand laminating using transfer adhesive
- ❖ Hand laminating using spray adhesive

## Cold Laminating with a Press using Adhesive-backed Paper

This process is most frequently used by commercial photo labs. Either of two types of liner films, a single release liner film or a double release liner film, can be used for this process. The basic process for laminating with a press using adhesive-backed paper is described in the following section.

1. Set the roller pressure properly for the thickness of the pre-coated mounting substrate.
2. Place the mounting substrate on a flat surface and expose approximately one inch of the adhesive by peeling back the release paper. Fold back the release paper, making an even crease across the paper.
3. Carefully position the print on top of the substrate, using the folded release paper to prevent contact with the exposed adhesive. Once positioned correctly, carefully apply the print to the exposed adhesive, pressing from the centre toward the edges to ensure a smooth tack.
4. Place the direction switch in the forward position and the speed control on medium.
5. Insert the materials to be processed into the laminator opening. Feed the substrate between the rollers until the pressure roller rests on the tacked portion of the material.
6. Hold the un-tacked portion of the print up and against the pressure roller. Feed the substrate through the rollers while peeling the release paper off the mounting substrate with one hand. To prevent wrinkles, the print must be held against the roller with the opposite hand while the substrate feeds through the press.
7. Remove the mounted print from the rear of the laminator and trim it to the required size.

## Coating using Single Release Liner Films

1. Set the pressure properly for the thickness of the substrate(s) to be processed.
2. Load the supply roll of pressure-sensitive adhesive.
3. Pull approximately 12 inches of adhesive film forward off the roll. Rest the film, adhesive side up, on top of the pressure roller.
4. Create a leader board by cutting a piece of substrate slightly larger than the width of the adhesive film and approximately four to six inches long. Lay the leader board across the adhesive film and smoothly adhere the bottom of the leader to the adhesive.
5. Place the direction switch in the forward position and the speed control on medium.
6. Pull the leader down and push it between the rollers. Feed the leader between the rollers approximately three to four inches. Be sure that the adhesive stays firmly adhered to the leader.
7. Once this process has been completed (referred to as "stringing the web") and the adhesive is feeding without wrinkles, the laminator is ready for production.
8. To coat, feed a substrate behind the leader board and between the rollers while depressing the foot switch. Feed until the substrate exits the rollers and automatically stops feeding. At this time, another substrate may be fed between the rollers for coating. This process is suitable for films with a paper release liner and leaves a 3/8" to 1/2" gap between the coated substrates to facilitate the trimming process.
9. After exiting the laminator, the coated substrates should be split apart and trimmed.

## Coating using Double Release Liner Films

Coating with double release liner film, requires the use of a take-up mechanism to automatically remove and rewind one of the release liners during the coating procedure.

1. Set the pressure properly for the thickness of the substrates to be processed.
2. Load the supply roll of pressure-sensitive adhesive.
3. Adhere double-stick tape or a pressure-sensitive adhesive film, to the surface of the take-up shaft.
4. Pull approximately 18 inches of adhesive film forward off the roll and adhere one release liner side smoothly to the take-up shaft, taking care to ensure that the film is square with the supply roll and no diagonal wrinkles are apparent.
5. Separate the adhesive film from the release liner secured to the take-up shaft and pulls the adhesive film and remaining release liner down so that it rests adhesive side up on top of the pressure roller.
6. Lay a leader board the same thickness as the substrates to be used across the exposed adhesive.

# FABRICATION GUIDE

## Cold Laminating with a Vacuum Press

This method is suggested for small and medium-sized photo shops for mounting prints utilizing a spray adhesive.

1. Spray the adhesive on the back of the piece to be mounted, keeping the spray six to eight inches from the surface. If using a double coat of adhesive, the second coat should be applied in a direction perpendicular to the first coat. For bonding most art materials, the adhesive is typically applied only to one surface, usually the back of the print.
2. Allow the spray to dry two to four minutes before mounting so that the adhesive becomes tacky. If blisters occur from trapped solvent, allow the adhesive to dry slightly longer than four minutes.
3. Position the print on the PALIGHT material and place inside the vacuum frame.
4. Apply vacuum for 10 minutes.

## Hand Laminating using Transfer Adhesive

For small shops or display makers without access to presses, this method can be used for the lamination of flat, relatively small items utilizing a transfer adhesive.

1. Using a sheet of transfer adhesive having both sides covered by release paper, peel away and fold back the release paper 1/2" inch from one edge.
2. Place the edge of the print to be laminated on the exposed adhesive.
3. Remove the rest of the release paper while lifting the print slightly to avoid contact with the adhesive, and then use a roller or a squeegee to smooth the print evenly onto the adhesive.
4. With the print facing down and the remaining release paper facing up, smooth out any excess air from between the print and the adhesive with a squeegee.
5. To laminate the print to the PALIGHT material, peel away and fold back the release paper 1/2" inch from one edge.
6. Placing the print evenly on the PALIGHT material, tack the exposed adhesive to the PALIGHT.
7. Gradually remove the liner while pressing closely with a hand roller or a squeegee to eliminate any air bubbles until the entire print has been laminated.

## Hand Laminating using Spray Adhesive

For small shops or display makers without access to equipment, this method is recommended for the lamination of flat, relatively small items utilizing a spray adhesive.

1. Spray the adhesive on the back of the piece to be mounted, keeping the spray six to eight inches from the surface. If using a double coat of adhesive, the second coat should be applied in a direction perpendicular to the first coat. For bonding most art materials, the adhesive is typically applied only to one surface, preferably the back of the print.
2. Allow the spray to dry between two to four minutes before mounting so that the adhesive becomes tacky.
3. Place the adhesive side of the print or other item on the PALIGHT surface, pressing smoothly from the centre of the piece to the edges in order to eliminate any wrinkles and trapped air immediately.
4. Place a clean sheet of PALIGHT over the laminated piece to weigh it down. Although the bond should be at maximum strength after fifteen minutes, allow 24 hours before exposing the piece to any sudden temperature or humidity changes.

## Delaminating

A print mount can be delaminated within five minutes if a pressure sensitive adhesive, has been used. Although the print is usually destroyed, the PALIGHT material can be reused. If five minutes have already passed, a hot air gun or a hair dryer can be used to heat the material in order to peel off the lamination. Isopropyl alcohol or mineral spirits can be used to remove the remaining adhesive.

## Chemical Resistance

The mechanism of chemical attack on thermoplastics in general, and PVC sheets in particular, differs significantly from the mechanism of corrosion of metals. Corrosion of metals results in a gradual loss of surface material as a result of electrolytic action by the relevant chemicals. Chemical attack on PVC sheet, where it occurs, consists generally of absorption of the chemical by the PVC sheet and its subsequent swelling. The chemical resistance behaviour of PVC sheets is therefore simple to determine. The chemical resistance is expressed in terms of weight change (usually an increase) and volume change. The table that appears in the following pages lists the resistance of PVC sheets to a number of commonly encountered chemicals and other corrosive media at room temperature. (Information on chemical resistance at higher temperatures will be supplied upon request.) Where the chemical resistance varies with concentration, the results of tests at different concentrations is presented. The information listed is based on long-term laboratory tests and actual service installations. It is important to note that PVC sheets are generally not recommended for use with acetone, ketones, ethers, and aromatic and chlorinated hydrocarbons. The information on chemical resistance is based on our research and experience. It serves as a basis for recommendation.

# PALIGHT

The table on the following pages uses the following key: R = Resistant LR = Limited Resistance (Gradual attack over time may occur) N = Not Resistant (rapid attack over short time period will occur)

Chemical	Concentration %	Resistance	Chemical	Concentration %	Resistance
Acetaldehyde	100	N	Brine		R
Acetic Acid	80	R	Bromic Acid		R
Acetic Acid	100	LR	Bromine (Liquid)		N
Acetic Anhydride		N	Bromine (Water)		LR
Acetone		N	Bromine (Vapour)		R
Acrylonitrile		N	Bromobenzene		N
Acetylene		R	Butadiene		N
Ajax		R	Butane		N
Allyl Alcohol		LR	Butyl Acetate		N
Aluminium Chloride	Saturated	R	Butyl Alcohol		R
Aluminium Fluoride		R	Butyl Stearate		R
Aluminium Hydroxide		R	Butyric Acid		N
Aluminium Sulfate	Saturated	R	Calcium Chloride	Saturated	R
Ammonia (Gas)		R	Calcium Hydroxide		R
Ammonia (Liquid)		N	Calcium Hypochlorite		R
Ammonium Acetate		R	Calcium Nitrate		R
Ammonium Bifluoride		R	Calcium Sulfate		R
Ammonium Bisulfate		R	Camphor		R
Ammonium Chloride		R	Carbon Dioxide Gas		R
Ammonium Fluoride	25	LR	Carbon Disulphide		N
Ammonium Hydroxide	28	R	Carbon Monoxide		R
Ammonium Nitrate		R	Carbon Tetrachloride		N
Ammonium Sulfate	Saturated	R	Castor Oil		R
Ammonium Sulfide	Saturated	R	Caustic Potash (Potassium Hydroxide)	50	R
Amyl Acetate		N	Caustic Soda (Sodium Hydroxide)	50	R
Amyl Alcohol	Pure	LR	Chlorine Dioxide	15	R
Aniline		N	Chlorine Gas (Dry)		N
Antimony Trichloride		R	Chlorine Gas (Wet)		N
Aqua Regia (3 parts HCl:1 part HNO3)		N	Chlorine Water	2	R
Arsenic Acid	80	R	Chloroacetic Acid		R
Barium Chloride		R	Chlorobenzene		N
Barium Hydroxide		R	Chloroform		N
Barium Sulfate		R	Chrome Alum	Saturated	R
Barium Sulfide		R	Chromic Acid	10	R
Beer		R	Citric Acid	Saturated	R
Beer (Sugar Liquor)		R	Copper Fluoride		R
Benzaldehyde		LR	Copper Nitrate		R
Benzene		N	Copper Sulfate		R
Benzoic Acid		R	Corn Syrup		R
Benzyl Alcohol		R	Cottonseed Oil		R
Bleach	12% Chlorine	R	Cresol		N
Boric Acid		R	Cresylic Acid	50	R
Brake Fluid		LR	Cupric Chloride	Saturated	R

# PALIGHT

Chemical	Concentration %	Resistance	Chemical	Concentration %	Resistance
Cuprous Chloride	Saturated	R	Hydrogen		R
Cyclohexane		N	Hydrogen Peroxide	50	R
Cyclohexanol		N	Hydrogen Sulfide		R
Cyclohexanone		N	Iodine		N
Dextrose		R	Kerosene		R
Detergent (most)		R	Ketones		N
Diesel Fuel		R	Lactic Acid	20	R
Diethyl Ether (Ethyl Ether)		R	Laurel Chloride		R
Dimethyl Amine		N	Lead Acetate		R
Diocetyl Phthalate		N	Lead Chloride		R
Dioxane		N	Lead Nitrate		R
Ethanol (Ethyl Alcohol) & Water	All	R	Lead Sulfate		R
Ethanol (Ethyl Alcohol)	Pure	R	Linoleic Acid		R
Ethyl Acetate		N	Linoleic Oil		R
Ethyl Chloride		N	Linseed Oil		R
Ethylene Chlorohydrin		N	Lithium Bromide		R
Ethylene Dichloride		N	Lubricating Oil		R
Ethylene Glycol		R	Magnesium Carbonate		R
Fatty Acids		R	Magnesium Chloride		R
Ferric Acetate		R	Magnesium Hydroxide		R
Ferric Chloride	Saturated	R	Magnesium Sulfate		R
Ferric Nitrate		R	Maleic Acid		R
Ferric Sulfate		R	Malic Acid		R
Ferrous Chloride		R	Manganese Chloride		R
Ferrous Hydroxide		R	Manganese Sulfate		R
Ferrous Sulfate		R	Mercuric Chloride		R
Fluorine Gas		LR	Mercuric Nitrate		R
Fluorine Gas (Wet)		R	Mercuric Sulfate		R
Fluoroboric Acid		R	Mercury		R
Formaldehyde		LR	Methanol & Water	All	R
Formic Acid		R	Methanol (Methyl Alcohol)	Pure	R
Freon 11, 12, 113, 114		LR	Methyl Chloride		N
Fluosilicic Acid		R	Methyl Ethyl Ketone (MEK)		N
Fruit Juices & Pulp		R	Methylmethacrylate		R
Gasoline		R	Methyl Sulfate		LR
Glucose		R	Methyl Sulfuric Acid		R
Glycerine		R	Methylamine		N
Heptane		R	Methylene Bromide		N
Hexane		N	Methylene Chloride		N
Hydrazine		N	Methylene Chlorobromate		N
Hydrobromic Acid	20	R	Methylene Iodide		N
Hydrochloric Acid	35	R	Milk		R
Hydrofluoric Acid	70	LR	Mineral Oil		R

# PALIGHT

Chemical	Concentration %	Resistance	Chemical	Concentration %	Resistance
Motor Oil		R	Propylene Oxide		N
Naphtha		R	Pyridene		N
Naphthalene		N	Pyrogallic Acid		R
Nickel Chloride		R	Salad Oil		R
Nickel Nitrate		R	Salicylic Acid		R
Nickel Sulfate		R	Selenic Acid		R
Nitric Acid	60	R	Silicic Acid		R
Nitrobenzene		N	Silver Cyanide		R
Nitroglycerine		N	Silver Nitrate		R
Nitrous Oxide		R	Silver Sulfate		R
Oleic Acid	Saturated	R	Sodium Acetate		R
Oxalic Acid		R	Sodium Benzoate		R
Oxygen		R	Sodium Bicarbonate		R
Ozone		R	Sodium Bichromate		R
Palmitic Acid		R	Sodium Bisulfate		R
Paracetic Acid	40	LR	Sodium Bisulfite		R
Perchloric Acid	70	LR	Sodium Carbonate		R
Phenol		N	Sodium Chlorate		R
Phosphoric Acid	85	R	Sodium Chloride		R
Phosphorous (Yellow)		R	Sodium Chlorite		N
Phosphorous Pentoxide		R	Sodium Cyanide		R
Phosphorous Trichloride		N	Sodium Dichromate		R
Photographic Chemicals		R	Sodium Ferricyanide		R
Prcric Acid		N	Sodium Ferrocyanide		R
Plating Solutions		R	Sodium Fluoride		R
Potassium Bichromate		R	Sodium Hydroxide	50	R
Potassium Bromate	Saturated	R	Sodium Hypochlorite	16% Chlorine	R
Potassium Chloride		R	Sodium Nitrate		R
Potassium Chlorate		R	Sodium Nitrite		R
Potassium Cyanide		R	Sodium Perchlorate		R
Potassium Dichromate		R	Sodium Peroxide		R
Potassium Ferricyanide		R	Sodium Sulfate		R
Potassium Fluoride		R	Sodium Sulfide		R
Potassium Hydroxide	50	R	Sodium Sulfite		R
Potassium Nitrate		R	Sodium Thiosulfate		R
Potassium Perborate		R	Stannic Chloride		R
Potassium Perchlorate		R	Stannous Chloride		R
Potassium Permanganate		R	Stearic Acid		R
Potassium Persulfate		R	Succinic Acid		R
Potassium Sulfate		R	Sugar	Saturated	R
Propane		R	Sulfur Dioxide (Dry Gas)		R
Propyl Alcohol (1 Propanol)	100	R	Sulfuric Acid	<80 (>80)	R (LR)
Propylene Dichloride		N	Sulfurous Acid		R

# PALIGHT

Chemical	Concentration %	Resistance	Chemical	Concentration %	Resistance
Tannic Acid		R	Trisodium Phosphate		R
Tanning Liquors		R	Tuepentine		LR
Tartaric Acid		R	Urea		R
Tetraethyl Lead		R	Vasilene		N
Tetrahydrofuran		N	Vegetable Oils		R
Tetrasodium Pyrophosphate		R	Vinegar		R
Thionyl Chloride		N	Vinyl Acetate		N
Titanium Tetrachloride		R	Water (demineralised or sea)		R
Toluene		N	Wine or Whiskey		R
Trichloroacetic Acid		R	Xylene		N
Trichloroethylene		N	Zinc Chloride		R
Triethanolamine		R	Zinc Nitrate		R
Triethylamine		N	Zinc Sulfate		R
Trimethylamine		LR			

# PALIGHT

## Recommended Uses and Restrictions

Please consult the relevant product and/or application information for this product within this guide, or in other related sales literature.

## Palight Physical Property Table

Property	Conditions	ASTM Method	Units	Value (3mm sheet)	Value (10mm sheet)
<b>Physical</b>					
Water Absorption	23°C	D-570	%	0.5	0.8
Density	-	-	g/cm <sup>3</sup>	0.65 – 0.7	0.55 – 0.6
<b>Mechanical</b>					
Tensile strength at yield	10mm/min	D-638	MPa	16	11
Elongation at break	10mm/min	D-638	%	30	20
Flexural strength at yield	10mm/min	D-790	MPa	28	22
Flexural modulus	10mm/min	D-790	MPa	900	900
Impact strength notch charpy	23°C	D-256	J/m	29	17
<b>Thermal</b>					
Service temperature	-	-	°F (°C)	-10 to 55°C	-10 to 55°C
Heat deflection temperature	-	D-648	°F (°C)	63	63
Vicat softening temperature	Load: 264psi	D-1525	°F (°C)	75	75
Coefficient of linear thermal expansion	Load: 11kg	D-696	Cm/cm°C	6.7	6.7
Thermal Conductivity	-	C-177	W/mk	0.07	0.07